DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1304; Project Identifier AD-2022-00347-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 767-300F airplanes. This proposed AD was prompted by a report indicating that the installation requirements were not followed for the first observer seat in the flight deck. This proposed AD would require installing placards in various locations of the flight deck to indicate the proper position for the first observer seat during taxi, takeoff, and landing, and revising the existing airplane flight manual (AFM). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to regulations.gov. Follow the instructions for submitting comments.
 - Fax: 202-493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West
 Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC
 20590.

Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2022-1304; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday

• Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m.,

comments received, and other information. The street address for Docket Operations is

through Friday, except Federal holidays. The AD docket contains this NPRM, any

Material Incorporated by Reference:

listed above.

- For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminster Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.
- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at regulations.gov by searching for and locating Docket No. FAA-2022-1304. **FOR FURTHER INFORMATION CONTACT:** Kumar Khatri, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3842; email: kumar.r.khatri@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under ADDRESSES. Include "Docket No. FAA-2022-1304; Project Identifier AD-2022-00347-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal,

explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Kumar Khatri, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3842; email: kumar.r.khatri@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA has received a non-compliance report indicating that the technical standard order installation requirements for the first observer seat in the flight deck were not followed. When the first observer seat, located in front of the supernumerary seats, is

in the furthest aft position on the seat tracks, the "head path stay out zone" is compromised. This condition, if not addressed, could result in occupants seated in the right or center supernumerary seats sustaining an injury during an emergency landing.

FAA's Determination

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Related Service Information under 1 CFR Part 51

The FAA reviewed Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022. This service information specifies procedures for installing markers (placards) in the flight deck regarding the position of the first observer seat position during taxi, takeoff, and landing.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in ADDRESSES.

Proposed AD Requirements in this NPRM

This proposed AD would require accomplishing the actions specified in the service information already described, except for any differences identified as exceptions in the regulatory text of this proposed AD. This proposed AD would also require revising the existing AFM to include procedures for briefing all occupants other than the flightcrew members regarding the first observer seat position for taxi, takeoff, and landing, as indicated by the placards installed in the flight deck.

Compliance with AFM Revisions

Section 91.9 prohibits any person from operating a civil aircraft without complying with the operating limitations specified in the AFM and on installed placards.

FAA regulations also require operators to furnish pilots with any changes to the AFM (14)

CFR 121.137) and pilots in command to be familiar with the AFM and installed placards containing operating limitations(14 CFR 91.505).

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 153 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

Estimated costs

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Placard installation	1 work-hour X \$85 per hour = \$85	Up to \$117	Up to \$202	Up to \$30,906
AFM revision	1 work-hour X \$85 per hour = \$85	\$0	\$85	\$13,005

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a

substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

The Boeing Company: Docket No. FAA-2022-1304; Project Identifier

AD-2022-00347-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to all The Boeing Company Model 767-300F airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 11, Placards and markings.

(e) Unsafe Condition

This AD was prompted by a report indicating that the installation requirements were not followed for the first observer seat in the flight deck. When the first observer seat, located in front of the supernumerary seats, is in the furthest aft position on the seat tracks the "head path stay out zone" is compromised. The FAA is issuing this AD to address this condition, which if not addressed, could result in occupants seated in the right or center supernumerary seats sustaining an injury during an emergency landing.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Placard Installation

Except as specified by paragraph (h) of this AD: At the applicable time specified in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Special Attention Service Bulletin 767-25-0589, dated February 25, 2022, which is referred to in Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022.

(h) Exception to Service Information Specifications

Where the Compliance Time column of the table in the "Compliance" paragraph of Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022, uses the phrase "the original issue date of Requirements Bulletin 767-25-0589 RB," this AD requires using "the effective date of this AD."

(i) Revision of Existing Airplane Flight Manual (AFM)

Within 12 months after the effective date of this AD, revise Section 3.1 of the Normal Procedures Section of the existing AFM to include the information in figure 1 to paragraph (i) of this AD. This may be done by inserting a copy of figure 1 to paragraph (i) of this AD into the existing AFM.

Figure 1 to paragraph (i): Flight deck occupancy (freighter airplane)

(Required by AD *****-**)

FLIGHT DECK OCCUPANCY (Freighter Airplane)

The following item should be briefed to all occupants other than flight crew members by the appropriate flight crew member, prior to pushback or engine start:

Occupant seat position for Taxi, Takeoff, and Landing as indicated by placards.

(j) Alternative Methods of Compliance (AMOCs)

- (1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.
- (2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.
- (3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(k) Related Information

For more information about this AD, contact Kumar Khatri, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3842; email: kumar.r.khatri@faa.gov.

(I) Material Incorporated by Reference

- (1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.
- (2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.
- (i) Boeing Special Attention Requirements Bulletin 767-25-0589 RB, dated February 25, 2022.
 - (ii) [Reserved]
- (3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminster Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website myboeingfleet.com.
- (4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.
- (5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

 Issued on October 12, 2022.

Christina Underwood, Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-26616 Filed: 12/8/2022 8:45 am; Publication Date: 12/9/2022]